



Firmware for EDS-P506E Series Release Notes

Version: v5.7	Build: 21071517
Release Date: Sep 15, 2021	

Applicable Products

N/A

Supported Operating Systems

N/A

New Features

- Supports Interface Tracking, Ping Tracking, and Logic Tracking.
- Supports many-to-many port mirroring.

Enhancements

- The CPU utilization now displays a percentage instead of "Normal" and "Busy".
- Firmware upgrade processing status is displayed.
- Email addresses can contain up to 39 characters.
- Email Mail Servers can contain up to 39 characters.
- Enhanced SSH with secure key exchange algorithm, Diffie-Hellman Group 14.
- Improved random distribution of TCP Initial Sequence Number (ISN) values.
- Added an additional encryption option and command to the web UI and CLI.

Bugs Fixed

- [MSRV-2017-002][CVE-2019-6563] Predictable Session ID: Supports random salt to prevent session prediction attack of HTTP/HTTPS.
- [MSRV-2017-003][CVE-2019-6526] Encryption of sensitive data is missing: Supports encrypted Moxa service with enable/disable button on the GUI to support the communication of encrypted commands with MXconfig/MXview.
- [MSRV-2017-004][CVE-2019-6524] Improper restriction of excessive authentication attempts: Supports encrypted Moxa service with enable/disable button on the GUI to support the communication of encrypted commands with MXconfig/MXview.
- [MSRV-2017-005][CVE-2019-6559] Resource exhaustion: Supports encrypted Moxa service with enable/disable button on the GUI to support the communication of encrypted commands with MXconfig/MXview.
- [MSRV-2019-006] Denial of Service by PROFINET DCE-RPC Endpoint discovery packets.
- The device would restart due to memory leak during the Nmap (a freeware that can scan the available ports) scanning test.
- RSTP Port Status error with Modbus TCP.
- Trunk port was not shown correctly in the LLDP table.
- The head switch of Turbo Chain was blocked when connecting to a Cisco switch.
- SNMP v3 memory leak.
- The device rebooted when performing a Nessus basic scan.
- MAC authentication bypass with RADIUS re-authentication.
- When SNMP pooled every 10 seconds, the system would perform a cold start after 25 minutes.
- The LLDP Table hung up in a serial console.
- Packet flooding from MGMT VLAN to redundancy port PVID VLAN.
- CERT could not be imported.
- Error with Turbo Ring v2 and port trunk LLDP display, recovery time and log miswrite.
- Relay warning did not work properly after the system rebooted.
- RSTP was not activated correctly through the configuration file import.



- Incorrect value for IGMP Query Interval on the exported configuration file.
- Logging into the web console failed if authentication with local RADIUS and account lockout were both enabled at the same time.
- Turbo Ring v2 looped when too many slaves in the ring were powered on at the same time.
- Switch automatically performed a cold start when receiving specific SNMPv3 packets.
- [CRM #200811300717] If a username had a capitalized letter then the user would not be able to log in using Menu mode.
- [CRM #190726273178] Unauthorized 802.1x devices could receive multicast and broadcast packets.
- [CRM #210115312454] Trap Server Host Name cannot be set via web GUI.
- [CRM #201019305310] Incorrect SNMPv3 msgAuthoritativeEngineBoots behavior that the value will not count up after switch reboot.
- [CRM #200702298391] The relay trigger function by port traffic overload does not work.

Changes

- The IEEE 802.1x traffic enablement method has changed from MAC-based to port-based.
- The length of the 802.1x username is increased from 32 bytes to 64 bytes.

Notes

- MSRV is Moxa's internal security vulnerability tracking ID.



Version: v5.6	Build: FWR_EDSP506E_V5.
Release Date: Feb 18, 2020	

Applicable Products

EDS-P506E Series

Supported Operating Systems

N/A

New Features

N/A

Enhancements

- [MSRV-2017-011][CVE-2019-6561] Supports browser cookie parameters “same-site” to eliminate CSRF attacks.

Bugs Fixed

- Login issue with Chrome v65.
- If the user configures an SNMP, New Moxa command, or Moxa command, the configurations disappeared from the exported configuration file.
- ABC-02 auto load configuration failed.
- [MSRV-2017-006][CVE-2019-6557] Buffer overflow vulnerabilities that may have allowed remote control.
- [MSRV-2017-007][CVE-2019-6522] An attacker could read device memory on arbitrary addresses.
- [MSRV-2017-009][CVE-2019-6565] No proper validation of user inputs, which allows users to perform XSS attacks.
- [MSRV-2017-011][CVE-2019-6561] CSRF attacks were possible if browser cookie parameters were not correct.

Changes

N/A

Notes

- MSRV is Moxa's internal security vulnerability tracking ID.



Version: V5.5	Build: 17110219
Release Date: Jan 18, 2019	

Applicable Products

EDS-P506E-4PoE-2GTXSFP, EDS-P506E-4PoE-2GTXSFP-T

Supported Operating Systems

N/A

New Features

First Release

The following major new functions have been added:

- All Turbo Pack 3 features
- 4-Pair High Power PoE and 4-Pair High Power Force Mode

Enhancements

N/A

Bugs Fixed

N/A

Changes

N/A

Notes

N/A