

Firmware for NE-4100 Series Release Notes

Version: v4.1 Build: Build 07061517

Release Date: Jul 09, 2008

Applicable Products

NE-4100T, NE-4100T-T, NE-4110S, NE-4110S-T, NE-4110A, NE-4110A-T, NE-4120S, NE-4120S-T, NE-4120A. NE-4120A-T. NE-4100-ST. NE-4110-ST. NE-4120-ST

Supported Operating Systems

N/A

New Features

• Resets settings to factory defaults when JP1 is shorted for 10 seconds.

Enhancements

• Adjusted serial command mode SW trigger checking timeout to 100 ms +/- 20 ms.

Bugs Fixed

- Telnet console "Backspace" had no effect when logging in with Linux.
- When HW and SW flow control were enabled simultaneously, SW flow control could not take effect.
- Text on web console "Auto report to TCP port" should be "Auto report to UDP port."
- The first connection in TCP client mode is reset if the "any character" option is set.
- Serial command mode SW trigger checking timeout was incorrectly set to 300 seconds.
- Serial command SW trigger checking timeout took no effect when the port was in use.
- Driver failed to open Real COM port when maximum connection was set to more than 1.
- Would not release command port (966) when port open was not successful.

Changes

N/A

Notes

• This version also supports NE-4110S-CMD, NE-4120S-CMD, NE-4100T-CMD, NE-4110A-CMD, and NE-4120A-CMD



Version: v4.0 Build: N/A

Release Date: N/A

Applicable Products

NE-4100T, NE-4100T-T, NE-4110S, NE-4110S-T, NE-4110A, NE-4110A-T, NE-4120S, NE-4120S-T, NE-4120A, NE-4120A-T, NE-4100-ST, NE-4110-ST, NE-4120-ST

Supported Operating Systems

N/A

New Features

- Supports PCB v2.1.
- Backward compatible with PCB v1.1.

Enhancements

N/A

Bugs Fixed

- Serial Command Mode data would be lost when open port -> send 17 KB data -> close.
- DIO port number could not be configured through NECI & Admin.
- DHCP or TCP Client option "any character" would cause CMD to not work.

Changes

N/A

Notes

• This version also supports NE-4110S-CMD, NE-4120S-CMD, NE-4100T-CMD, NE-4110A-CMD, and NE-4120A-CMD